

TECHNICAL BULLETIN

IMPORTANT PLEASE READ

15/12/2020

Twinflex-V3 Checkpoint Plus EOL

It has come to our attention that there is a potential issue when using the following detector types as EOL on Older Twinflex checkpoint plus panels discontinued in 2009,

Twinflex ASD Multipoint	204-0003
Twinflex ASD Multipoint with sounder	204-0001
Twinflex ASD Multipoint strobe	204-0012





This is due to the new technology within the ASD detector processing data more efficiently, The older checkpoint plus panels do not have the processing power to read the data

UNPLANNED OPERATION

The device will flash as EOL but the panel will not be equipped to read the data

PANELS IMPACTED

Twinflex V3	2 Zone	502-0002
Twinflex V3	4 Zone	502-0004
Twinflex V3	8 Zone	502-0008

PANEL IMPACT

Fault/Disable/Test LED Flashing at the same time as buzzer Fault LED continuous

No 'End of Line' signal is being received

RESOLUTION

The following parts may be used as EOL

Twinflex Multipoint with sounder 202-0001 Twinflex Call point 402-0006

The older Twinflex Multipoint detectors are still available on request while stocks last

End of bulletin